


SAFETY RECALL NOTICE

2011-2015 Cannondale Mountain Bikes equipped with One Piece Integration (OPI) Stem



OPI Stem
(handlebar stem)

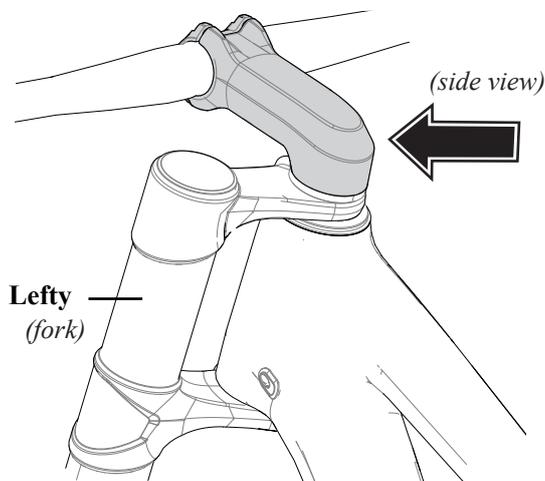

Your bike is affected by this recall if it has an OPI stem.

Recalled Product: This recall affects Cannondale mountain bikes produced between 2011-2015 with a Lefty front fork assembled with a component known as an “OPI Stem” and an “OPI Steerer.” The OPI Steerer is being recalled. It is located inside the headtube and is not visible. The Lefty fork and the OPI Stem ARE NOT being recalled.

- OPI Stems are marked with the “OPI” logo in black with a white stripe above. OPI Stems look smooth and are rounded at the bike head tube.
- OPI Stems have no stem bolts, only 4 handlebar bolts.

Use the illustration above to identify a bike subject to recall.

Manufacturer / Importer / Cycling Sports Group Inc., of Wilton, Connecticut.

Hazard : OPI steerers affected by this recall have reduced fatigue life which could lead to breakage of the fork clamps or bolts over time. If that happened, a rider could lose control leading to an accident.

Remedy: Consumers with a bicycle equipped with an OPI stem should immediately stop using the bicycle and contact the nearest Authorized Cannondale Bicycle Dealer. Cannondale Dealers will inspect the bicycle OPI stem and fork for any damage that may have occurred and fit the OPI stem steerer system with a reinforcement part and install new Lefty clamp bolts.

Find a Authorized Cannondale Dealer at: www.cannondale.com

Questions about this safety recall?
Contact Cycling Sports Group Inc. at 1-800-BIKE-USA (1-800-245-3872)

This recall is being conducted in cooperation with the U.S. Consumer Product Safety Commission.

Recall Notice at:
<http://www.cannondale.com/recalls>