

# Product Safety Recall



## Baby Stroller

**Multifunctional Luxury Baby Stroller 8EC546(4008) or  
Online Dealz 4 Wheel Pram, CTN 47-100, 8EC546**

This recall is related to an order by the Federal Court of Australia  
(See ACCC Media Release: [Online Dealz and its director Janet Lucas  
to pay \\$120,000 in penalties for selling unsafe baby cots and strollers](#))

**Defect:** The stroller does not comply with the requirements of the  
mandatory standard AS/NZS 2088:2000.

**Hazard:** The stroller failed to comply with the various design, safety and  
performance and marking requirements of the mandatory standard. The  
product poses numerous risks, including an entrapment and fall hazard, to  
infants using this product. More information on the hazards is available  
below.

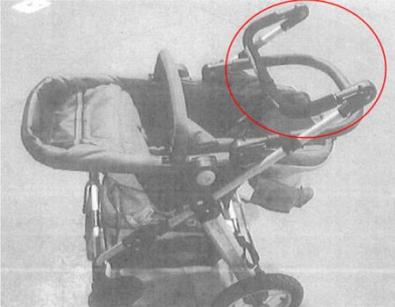
### **What should consumers do?**

Stop using the stroller immediately and dispose of it appropriately. If you  
have gifted or sold the stroller to someone, please inform them of this recall  
and ask them to dispose of the stroller appropriately. Online Dealz is no  
longer trading and as a result there is no avenue for remediation for  
consumers.

**See [productsafety.gov.au](http://productsafety.gov.au) for  
Australian product recall information**

## STROLLER – HAZARDS

The stroller failed to meet the mandatory standard in the following ways:

| Failure  | Hazard   |
|--|--|
| 1. The waist straps are not effectively secured, and displacement of the seating surface was observed when the waist straps were pulled  | Falling hazard   |
| 2. The gap between the reclining surface and the handle when in certain positions is less than 250mm– see picture below:   | Entrapment hazard to children’s heads.   |
|    |  |
| 3. The gap between the handle and the stroller seat is obstructed by the canopy support bar when it is in the second and third lowest positions – see picture below:   | Entrapment hazard to children’s heads.   |
|   |  |
| 4. The following information is not marked in accordance with the requirements of the mandatory standard: <ul style="list-style-type: none"> <li>• Registered trade name and address in Australia or New Zealand of either the manufacturer, importer or other supplier</li> <li>• Model name or number</li> </ul> | These details are not adequately identified to consumers.  |
| 5. The warning notice present on the frame was not permanently marked.   | The warning notice may rub off, resulting in the safety warnings not being adequately identified to consumers. |